

Installation Guide

Mounting


Hollow wall installation:

1. Cut a 1-3/32" square cutout.
2. Remove cover from unit.
3. Mount the black unit back using two 7/64" screws.

Electrical box installation

1. Attach the HMO-6036 universal backplate horizontally or vertically to the electrical box with two screws (included).
2. Mount the black unit back to the backplate using two 5 /32" screws.

Hollow Wall Cutout

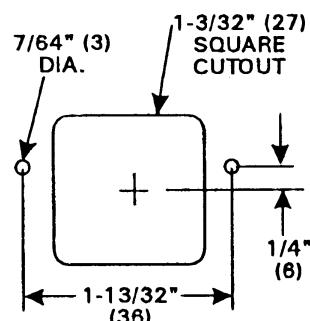


Wiring

Refer to the wiring diagram.

The internal thermistor connects one side common to signal ground.

Refer to the I/O for REE-2002 for additional application specific information

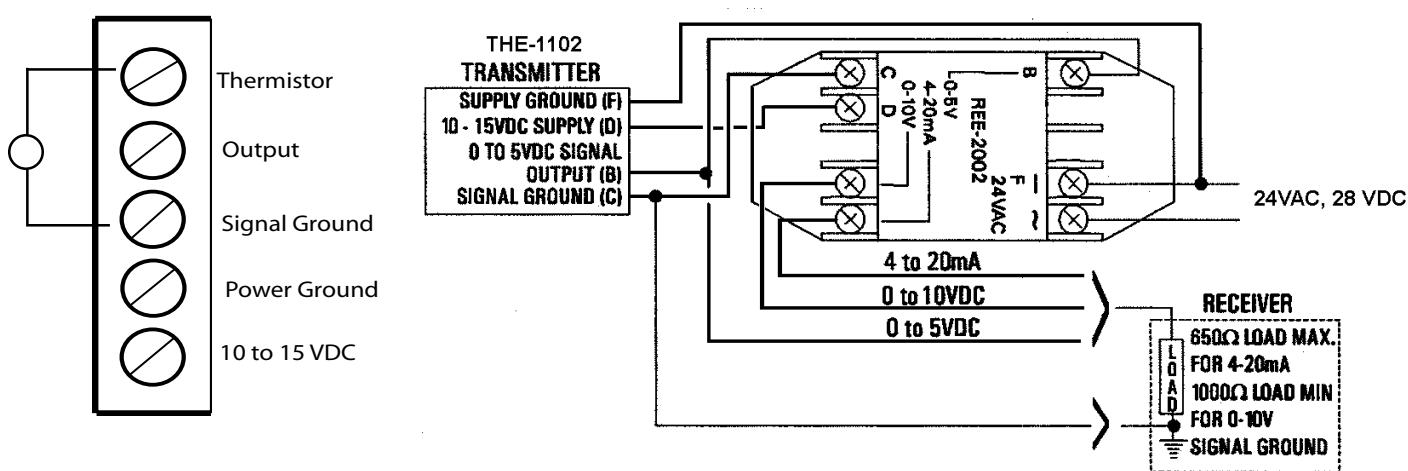

Maintenance

No routine maintenance is required. Each component is designed for dependable, long term reliability and performance. Careful installation will also ensure long term reliability and performance.

KMC Controls

P.O. Box 497
19476 Industrial Drive
New Paris, IN 46553
U.S.A.
TEL: 574.831.5250
FAX: 574.831.5252
E-mail: info@kmccomtrols.com